

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 1

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date: 7-07-12 Tooling:

Date:

Run Start



QC:

Date: SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D407-667-205 CH006

CH007

8/10/04

11/08/04

110

0.00



Pick Kit

Packaging

Packaging

Memo

0.00

Packaging

DP 11-7-26

120

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend tube as per Dwg D407-667-245 using CNC bender program 407 Aft and Folio 21

DP 11-7-26

D407 667 205 B 71825

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 2

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00



QC

Memo

0.00

Quality Control

① PB 11-07-27

PTO

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11-07-27	30	Inspection Sheet has incorrect Dimensions	<i>[Signature]</i> Chief Eng	Correct and update Inspection Sheet			<i>[Signature]</i> 25/12	<i>[Signature]</i> 11-07-27

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM

Page 3

Item ID: D407-667-205

Accept

Revision ID:

Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00

Required Date: 7/20/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140



Crosstubes

Crosstubes

Crosstubes

Memo

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245

6-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Note: Aft side has 3x top holes.

7-Drill Fwd rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Drill only the top (3) holes.

8-C'sink holes as per Dwg D407-667-245. Allow rivet to sit below surface to compensate for paint.

9- Scribe tube to identify on the inner chamfer in the cuff D# and B#

10-Deburr & Inspect for surface damage. Repair damage within limits as per

SAD
11-07-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 4

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Dwg D407-667-245

150

Crosstubes Chemical Conversion

0.00

SAD 11-07-28

①



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

ml 11 07 28 ①

170

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

ml 11 07 28 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM

Page 5

Item ID: D407-667-205

Accept

Revision ID:

Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00

Required Date: 7/20/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180	Outsource process - NDT per QSI038 4.1	0.00							
-----	--	------	--	--	--	--	--	--	--



Outsource2

Memo

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 0380
Issue P/O: 14604 LPI as per ASTM 1417
Level 2 Attach copy of NDT results to work order11-08-2

190	Packaging	0.00							
-----	-----------	------	--	--	--	--	--	--	--



Packaging

Memo

Packaging

Ensure copy of NDT results attached to work order.

11-08-20

200	QC5- Inspect part completeness to step on W/O	0.00							
-----	---	------	--	--	--	--	--	--	--



QC

Memo

Quality Control

11-07-29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 6

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

210

0.00



SprayPaint

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per DEO D407-667-245 and QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PRIME:

Start Time: _____

Finish Time: _____

11 07 27

PAINT:

Start Time: _____

Finish Time: _____

11 07 30

25 11 07 30

220

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

① 8 11.08.02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 7

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

230

0.00



Crosstubes

Crosstubes

Memo

0.00

1- Install chafing shield as per DEO D407-667-245. Note: (3) top holes should be facing up.

Good seal 118234

2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

3- Install support with magnobond and install clamps as per Dwg D407-667-245 using installation jig DT9025. Torque clamps to 80-100 in lb

A/R Magnobond

Batch:

EXP:

116677
12-02

4- Install nut plates as per Dwg D407-667-245. Touch-up rivet heads with Imron paint.

BT 11 - 0802

240

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

S. Wosley

@

Quality Control

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 8

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

250

Pick Kit

0.00



Packaging

Memo

0.00

Packaging

260

QC4- 100% Inspect kits for completeness

0.00



QC

Memo

0.00

Quality Control

270

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and in kanban rack
Location: _____

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 71825

Tuesday, July 12, 2011 2:30:09 PM



Page 9

Item ID: D407-667-205

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 7/12/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

211-085
①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, July 12, 2011 2:30:15 PM

Page 1

Work Order ID: 71825

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft



Start Date: 7/12/2011

Required Date: 7/20/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:C 05.09.02 Add holes for compatibility with Bell Skidtubes KJ/JLM
IPP Rev:D Added Magnobond, Rubber Cushion & Clamps 07-02-19
JLM

****CHANGE TO CHG 005 - IF USING D2894-1 B35578 OR GREATER****

IPP Rev:E 08-05-22 add comment in seq. 6 and QC15 and QC5 DD verified by:EC

IPP Rev:F 08-06-12 add comment in seq. 24 DD verified by:EC

IPP Rev:G 08-08-19 revE as per dwg DD verified by:EC

IPP Rev:H 09.01.06 ECN 08-562 EC verified by:DD IPP Rev:I

10.04.07 revise route seq. in bom DD verified by:JLM IPP Rev:J

11.04.26 removed abrasion strip ecn 11-551 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D407-667-205TRN

Manufactured

No

110

Each

2.0000

1

1



Crosstube Turning Detail

B71821



① DP 11-7-26

Location

Loc Qty

Loc Code

LG003

2

70051

1

70052

1

AN960JD516

NAS1149D0563J

Purchased

No

230

Each

0.0000

18

18



Washer

D2873-043

Manufactured

No

230

Each

8.0000

2

2



Nut Plate Assembly

71306



M118206

ET 11-08-03

Location

Loc Qty

Loc Code

LG

8

68801

8

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, July 12, 2011 2:30:15 PM

Page 2

Work Order ID: 71825

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 7/12/2011

Required Date: 7/20/2011

Start Qty: 1.00

Required Qty: 1.00

D2873-045

Manufactured No

230

Each

3.0000

2

2



Nut Plate Assembly

71983



BT 11 08 03

Location

Loc Qty

Loc Code

LG

2

68800

2

LG052

1

65992

1

D2894-1

Manufactured No

230

Each

8.0000

1

1



2.750 Support

68632



BT 11-08-02

Location

Loc Qty

Loc Code

LG

4

66702

4

LG052

4

43881

4

D3190-1

Manufactured No

230

Each

14.0000

2

2



Chafing Shield



BT 11 08 02

Location

Loc Qty

Loc Code

LG

14

68372

14

D3595-063-450

Manufactured No

230

Each

121.0000

2

2



RUBBER CUSHION



BT 11-08-02

Location

Loc Qty

Loc Code

LG

121

67353

3

68893

6

70113

32

71354

80

X2

Tuesday, July 12, 2011 2:30:15 PM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, July 12, 2011 2:30:15 PM

Page 3

Work Order ID: 71825

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 7/12/2011

Required Date: 7/20/2011

Start Qty: 1.00

Required Qty: 1.00

MS20601-AD4W8

Purchased

No

230

Each

239.0000

14

14



RIVET

118454 x 11



85 11-08-03

Location

Loc Qty

Loc Code

LG

100

108521

100

LG051

139

117106

7

117381

32

117979

100

MS21920-22

Purchased

No

230

Each

113.0000

4

4



Clamp(per MIL-DTL-8783C)



85 11-08-02

Location

Loc Qty

Loc Code

LG050

113

116207

7

117279

6

117506

50

118186

50

MS21920-25

Purchased

No

230

Each

136.0000

2

2



Clamp(per MIL-DTL-8783C)



85 11-08-02

Location

Loc Qty

Loc Code

LG

100

113281

0

113282

0

118142

50

118183

50

LG050

36

116264

2

117998

34

x2

Tuesday, July 12, 2011 2:30:16 PM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, July 12, 2011 2:30:16 PM

Page 4

Work Order ID: 71825

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 7/12/2011

Required Date: 7/20/2011

Start Qty: 1.00

Required Qty: 1.00

AN5-10A

Purchased

No

250

Each

312.0000

10

10



Bolt

Location

Loc Qty

Loc Code

ST337

312

116704

16

117795

125

117872

99

118191

72



Handwritten: 118191

AN5-32A

Purchased

No

250

Each

214.0000

4

4



Bolt

Location

Loc Qty

Loc Code

ST340

214

117161

29

117514

50

117688

25

117872

60

118191

50



Handwritten: 117872

AN5-34A

Purchased

No

250

Each

98.0000

4

4



Bolt

Location

Loc Qty

Loc Code

ST340

98

117010

8

117366

20

117794

70



Handwritten: 118451

Tuesday, July 12, 2011 2:30:16 PM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, July 12, 2011 2:30:16 PM

Page 5

Work Order ID: 71825

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft



Start Date: 7/12/2011

Required Date: 7/20/2011

Start Qty: 1.00

Required Qty: 1.00

MS21042L5

Purchased

No

250

Each

1,388.000

4

4



Nut



2011/8/5

Location

Loc Qty

Loc Code

ST300

1388

116105

5

116548

199

117441

498

117591

100

117611

90

118179

496

117591

Tuesday, July 12, 2011 2:30:16 PM

Shop Packet Print

Page 5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	71825
Description: Crosstube High Aft (407)		Part Number:	D407-667-205
Inspection Dwg: D407-667-245 Rev: F		Page 1 of 1	

Required Dimension	Min	Max
Height	23.46, 79	23.58, 65
1/2 Span	45.86, 79	45.98, 65
Angle	54	56
Total Span	91.72, 58	91.96, 10

11-07-27

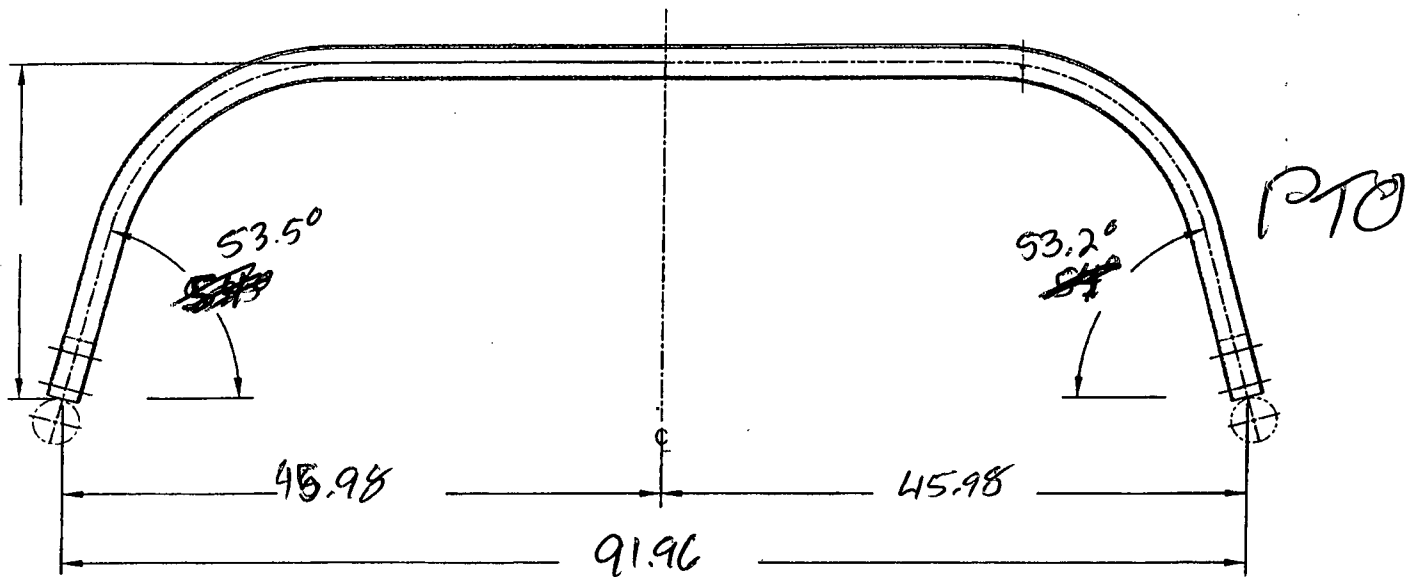

Passes 13 per side Comments

QC15 Inspection	11-07-27
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.06.22	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D407-667-205 PAR #: N/A Fault Category: CROSS TOLERANCES NCR: Yes No DQA: JS Date: 11-08-11
 Resolution: UAI Disposition: UAI QA: N/C Closed: ✓ Date: 11/08/11

NCR: <u>71825</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11-07-27	130	Angles below tolerance 0.5° & 0.8°	<u>JS</u> <u>29542</u>	Acceptable	<u>JS</u> <u>11-7-27</u>	<u>JS</u> <u>29542</u>	<u>JS</u> <u>29542</u>	<u>JS</u> <u>11-07-27</u>

NOTE: Date & initial all entries

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO
PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE
SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF
CROSSTUBE, PER QSI 035.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE
OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 71825
11-07-12

DEO ATTACHED

RELEASED
08/11/12

F	REFORMAT NOTES TO NEW STANDARDS (ZN 88-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECR#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	RF	D407-667-245	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			






NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

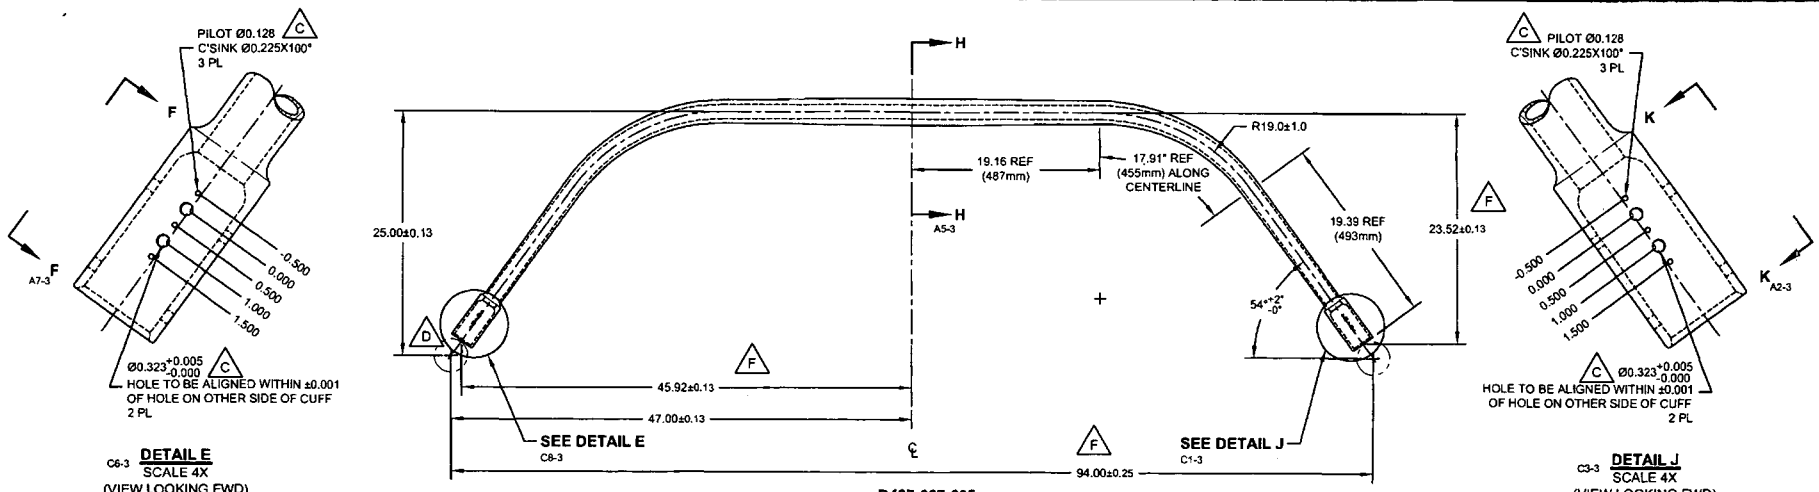

D407-667-605
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

DEO ATTACHED RELEASED
08/11/06

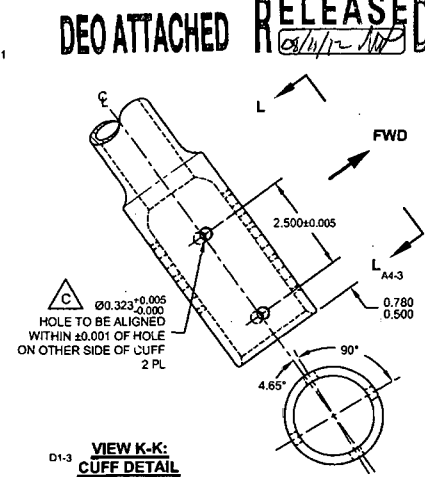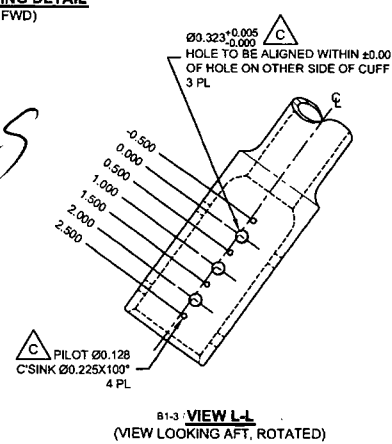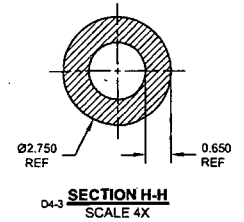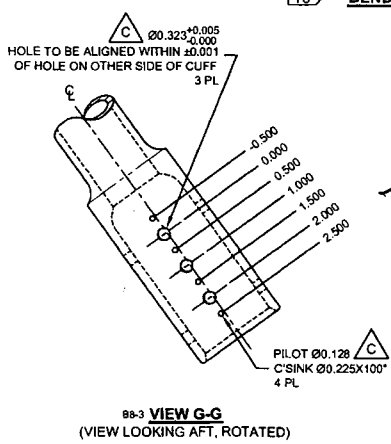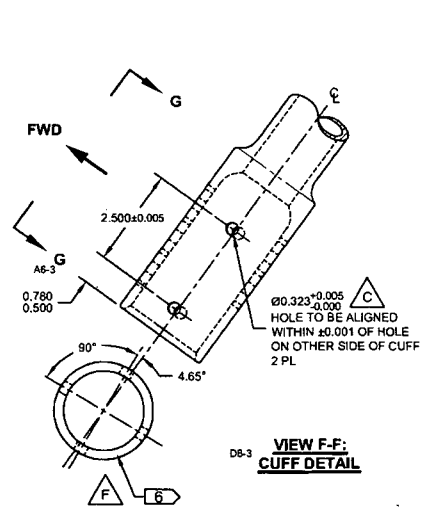

DESIGN	7	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	CP	DRAWING NO.	REV. F
MFG. APPR.	EF	D407-667-245	SHEET 3 OF 4
APPROVED	EF	TITLE	SCALE
DE APPR.	EF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

SEE DETAIL M
A7-4

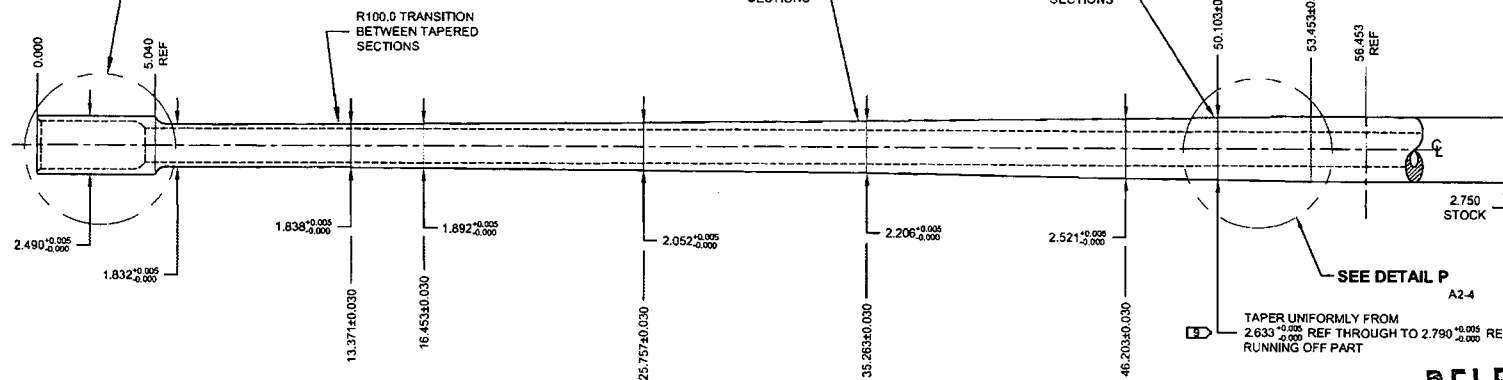


D407-667-245 MACHINING DETAIL


RELEASED
08/11/12 JMD

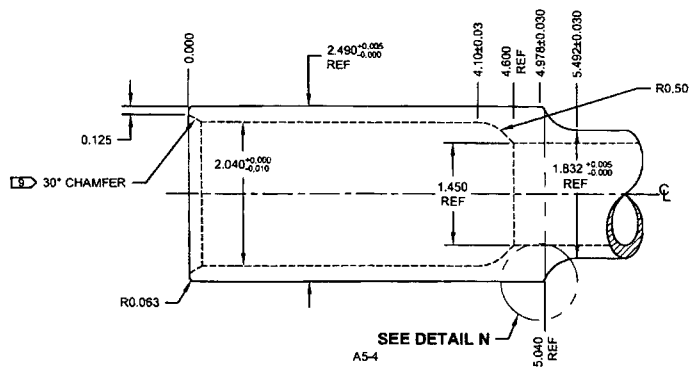

DETAIL M: CROSSTUBE CUFF
SCALE 3X

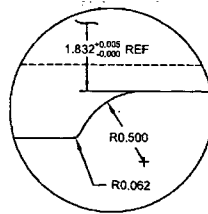

DETAIL N: CUFF TRANSITION
SCALE 2X

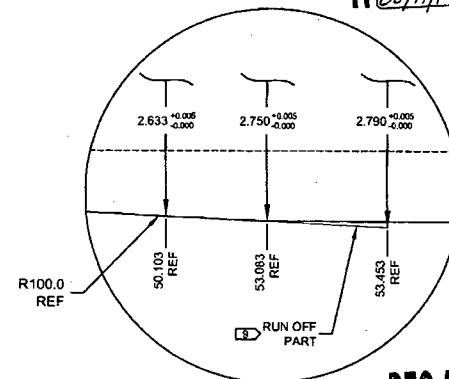

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

DEO ATTACHED

DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. F
MFG. APPR.	90	D407-667-245	SHEET 4 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN <i>A</i>	CHECKED <i>97</i>	MFG. APPR. <i>E</i>	APPROVED <i>140</i>	DE APPR. <i>#</i>			
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11-04-12			

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

RELEASED
2011-04-18
MD

71825

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F.1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>RE</i>	APPROVED <i>WP</i>	DE APPR. <i>TH</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASE
2011-04-18

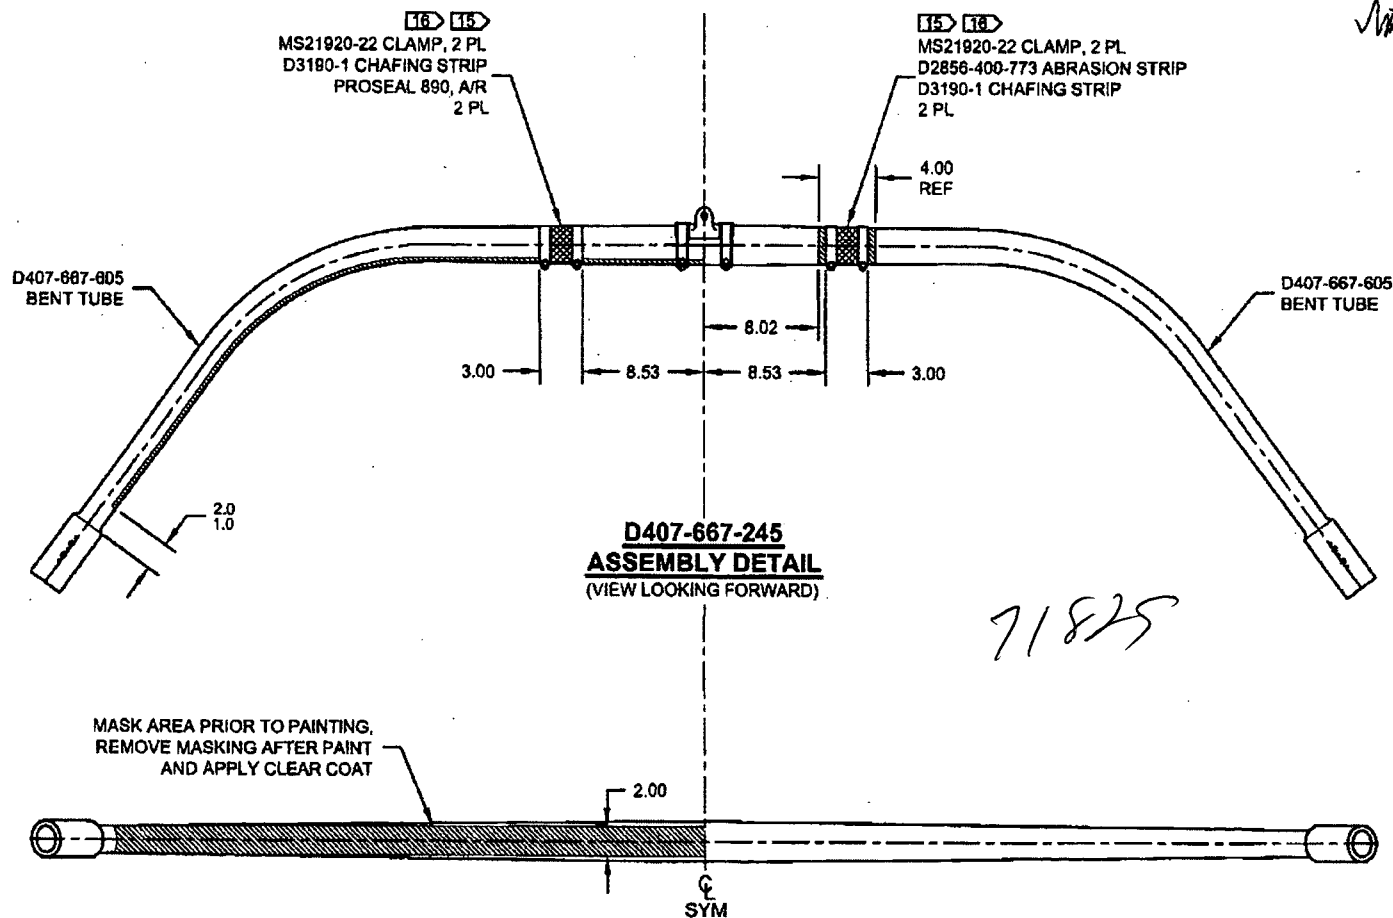

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P-05625

CLIENT DART AEROSPACE
ATTENTION LYNDA/CHANTALE/IAN
ADDRESS 1270 ABERDEEN RD
HALSBURY ON
PROJECT PT WET FLUORESCENT ON 9 CROSSBARS & 4 RAPPELS
ITEM(S) EXAMINED

DATE July 29/2011 PAGE 1 OF 1
TIME AM ☒ PM ☐
ACUREN JOB NO. 183-11-02163
PO/NO. 14604
WORK LOCATION AS ADDRESS
ACCEPTANCE STD. ASTM E1654-03 REV./DATE 2005

OB DESCRIPTION PERFORMED A WET FLUORESCENT LIQUID PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE ON ITEMS MENTIONED BELOW
ART NO. ALUMINUM MATERIAL ALUMINUM THICKNESS N/A
COPE PERFORMED A WET FLUORESCENT LIQUID PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE ON ITEMS MENTIONED BELOW

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☐ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 13798 ☐ OUTPUT > 1000 μ W/CM² ☐ AMBIENT < 2 fc
PENETRANT ZL-64 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER
DEVELOPER SKD-53 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY CAL DUE DATE ALBSTER

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < - 4°C/ 20°F ☐ - 4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)
1 CROSSBAR W.O. ID 6957 72017 72054 71825 71824 72260 71437 72018 71438 6962
2 " W.O. ID 72017
3 " W.O. ID 72054
4 " W.O. ID 71825
5 " W.O. ID 71824
6 " W.O. ID 72260
7 " W.O. ID 71437
8 " W.O. ID 72018
9 " W.O. ID 71438
10 RAPPEL W.O. ID 6962
ITEM ID D407-667-205 D212-664-101MB D212-664-101 D407-667-205 D407-667-205 D212-664-101 D212-664-201 D212-664-201MB D212-664-201
ITEM ID D3011-1
RT 11-07-29
NO RELEVANT INDICATION WAS DETECTED
AS PER APPLICABLE STANDARDS

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.
Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES
CLIENT REPRESENTATIVE IAN TITLEY PRINT IAN TITLEY SIGNATURE
TECHNICIAN (SIGNATURE): JAMES DESKALIER PRINT JAMES DESKALIER SIGNATURE
NAME (PRINT): JAMES DESKALIER 1ST TECHNICIAN 2 CGSB LEVEL 2 SNT LEVEL 2 CGSB REG. NO. 3049
2ND TECHNICIAN — CGSB LEVEL — SNT LEVEL — CGSB REG. NO. —
DTR # 244712
REPORT REVIEWED BY: —
NAME INITIALS

REFERENCE ONLY**5.0 PARTS LIST****5.1 HIGH GEAR CROSSTUBES**

Item	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
		X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
			X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
				X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
					X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
						X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1	1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2		1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3			1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4				1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5					1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6						1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10	*2	*2	*2		*2		D2891-1	SUPPORT
11				*2			D2892-1	SUPPORT
12						*1	D2894-1	SUPPORT
13	*4	*4	*4		*4		D3595-063-395	RUBBER CUSHION
14				*4			D3595-063-450	RUBBER CUSHION
15						*2	D3595-075-430	RUBBER CUSHION
16	*4	*4	*4		*4		MS21920-20	CLAMP
17				*4		*4	MS21920-22	CLAMP
18						*2	MS21920-25	CLAMP (OR MS21920-24)
19	4	4	4		4		AN5-32A	BOLT
20				4		4	AN5-34A	BOLT
21	4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22	8	8	8	8	8	8	NAS1149C0563J	WASHER (OR AN960JD516)
23						*2	D3190-1	CHAFING SHIELD
40	*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41	*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42		2					D2872-043	NUT PLATE
43		2					D2872-045	NUT PLATE
44	10		10				AN5-7A	BOLT
45		10		10	10	10	AN5-10A	BOLT
46	4	10	4		4		AN5-30A	BOLT
47				4		4	AN5-32A	BOLT
48			12				AN970-4	WASHER (OPTIONAL)
49		6					MS21042L5	NUT (OR MS21042-5)
50	10	12	10	10	10	10	NAS1149C0563J	WASHER (OR AN960JD516)
60		1					D3039-3	CENTER DRILL (TOOLING, NOT INSTALLED)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/-143/-241/-243 & D407-667-145/-245
ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD. •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: D

Date: 11.05.01